



Playground Safety Inspection Report

Member: West Allis

Inspection Date: 5-28-2025

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

<u>Id</u>	<u>Location</u>	<u>Observation/Recommendation</u>
19858	Rogers Playground	Accessibility

If the use zone of a playground is not entirely surfaces with an accessible material, at least one accessible route within the use zone shall be provided from the perimeter to all accessible play structures or components within the playground. For accessible play components, such as slides, where the access and egress point are not the same, an accessible route will be provided at both points.
ADA 2010 105.2.3

Recommendation

An ADA accessible route must be provided to get to the playground and also to gain access to all accessible play structures or components within the playground.



Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

<u>Id</u>	<u>Location</u>	<u>Observation/Recommendation</u>
19859	Rogers Playground	Signage and/or Labeling

Although the intended user group should be obvious from the design and scale of equipment, signs and/or labels posted in the playground area or on the equipment should give some guidance to supervisors as to the age appropriateness of the equipment.
CPSC 2.2.6

Recommendation

Signs should be posted to give guidance as to the age appropriateness of the playground equipment.



Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

<u>Id</u>	<u>Location</u>	<u>Observation/Recommendation</u>
19860	Rogers Playground	Hardware

All fasteners, connectors, and covering devices that are exposed to the user should be smooth and should not be likely to cause laceration, penetration, or present a clothing entanglement hazard.
CPSC 2.5.2

Recommendation

Repair, replace, or properly cover hardware.



Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

<u>Id</u>	<u>Location</u>	<u>Observation/Recommendation</u>
19861	Rogers Playground	Hardware

When installed in accordance with the manufacturer's instructions, fasteners, connecting, and covering devices shall not loosen or be removable without the use of tools. Lock washers, self-locking nuts, or other locking means shall be provided for all nuts and bolts to protect them from detachment. Hardware in moving joints shall also be secured against unintentional loosening.

ASTM-F1487 4.2.2

Recommendation

All hardware should be installed so that it will not loosen or can not be removed without the use of tools. The panel is slightly loose and should be tightened.



Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

<u>Id</u>	<u>Location</u>	<u>Observation/Recommendation</u>
19862	Rogers Playground	Sharp Points, Corners or Edges

All metal edges should be rolled or have rounded capping.
CPSC 3.4

Recommendation

Sharp points, corners, or edges on any part of the playground or playground equipment may cut or puncture a child's skin. Sharp edges can cause serious lacerations if protective measures are not taken. It appears that some of the equipment is missing, and a sharp edge that should be removed.



Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

<u>Id</u>	<u>Location</u>	<u>Observation/Recommendation</u>
19863	Rogers Playground	Hardware

When installed in accordance with the manufacturer's instructions, fasteners, connecting, and covering devices shall not loosen or be removable without the use of tools. Lock washers, self-locking nuts, or other locking means shall be provided for all nuts and bolts to protect them from detachment. Hardware in moving joints shall also be secured against unintentional loosening.

ASTM-F1487 4.2.2

Recommendation

All hardware should be installed so that it will not loosen or can not be removed without the use of tools. The end of the climber is loose and could be tightened.



Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

Id Location Observation/Recommendation
19864 Rogers Playground Slides

All slides should have an exit region to help children maintain their balance and facilitate a smooth transition from sitting to standing when exiting. For preschool and school-age the chute exit region should: - Be at least 11 inches long. - Be no more than 11 inches above the protective surfacing if the slide is no greater than 4 feet high. - Be at least 7 inches but not more than 15 inches above the protective surfacing if the slide is over 4 feet high.
CPSC 5.3.6.4

Recommendation

The slide chute exit is too high above the protective surfacing material.



Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

<u>Id</u>	<u>Location</u>	<u>Observation/Recommendation</u>
19865	Rogers Playground	Maintenance

Loose-fill surfacing materials require special maintenance. High-use public playgrounds, such as child care centers and schools, should be checked frequently to ensure surfacing has not displaced significantly, particularly in areas of the playground most subject to displacement (e.g., under swings and slide exits).
CPSC 4.3

Recommendation

Mark ideal surfacing depths on equipment posts.
Displaced loose-fill surfacing should be raked back into proper place so that constant depth is maintained throughout the playground.



Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

<u>Id</u>	<u>Location</u>	<u>Observation/Recommendation</u>
19866	Rogers Playground	Sharp Points, Corners or Edges

All metal edges should be rolled or have rounded capping.
CPSC 3.4

Recommendation

Sharp points, corners, or edges on any part of the playground or playground equipment may cut or puncture a child's skin. Sharp edges can cause serious lacerations if protective measures are not taken. The swing has a split exposing the metal belt.



Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

<u>Id</u>	<u>Location</u>	<u>Observation/Recommendation</u>
20146	Roosevelt Park	Maintenance Inspections alone do not constitute a comprehensive maintenance program. Any problems found during the inspection should be noted and fixed as soon as possible. All repairs and replacements of equipment parts should be completed following the manufacturer's instructions. CPSC 4.2



Recommendation

The sign for the park is missing.

Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

<u>Id</u>	<u>Location</u>	<u>Observation/Recommendation</u>
20147	Roosevelt Park	Maintenance Inspections alone do not constitute a comprehensive maintenance program. Any problems found during the inspection should be noted and fixed as soon as possible. All repairs and replacements of equipment parts should be completed following the manufacturer's instructions. CPSC 4.2



Recommendation

The age-appropriate sign is covered by a sticker.

Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

Id Location
20148 Roosevelt Park

Observation/Recommendation

Maintenance

Inspections alone do not constitute a comprehensive maintenance program. Any problems found during the inspection should be noted and fixed as soon as possible. All repairs and replacements of equipment parts should be completed following the manufacturer's instructions.

CPSC 4.2

Recommendation

The musical play panel is damaged.



Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

Id Location
20149 Roosevelt Park

Observation/Recommendation

Maintenance

Inspections alone do not constitute a comprehensive maintenance program. Any problems found during the inspection should be noted and fixed as soon as possible. All repairs and replacements of equipment parts should be completed following the manufacturer's instructions.

CPSC 4.2

Recommendation

All hazards found during inspections should be eliminated as soon as possible. Repairs and replacements should also be documented. The surfacing on the playground has been damaged and should be patched.



Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

Id Location
20150 Roosevelt Park

Observation/Recommendation

Maintenance

Inspections alone do not constitute a comprehensive maintenance program. Any problems found during the inspection should be noted and fixed as soon as possible. All repairs and replacements of equipment parts should be completed following the manufacturer's instructions.

CPSC 4.2

Recommendation

The repair to the play panel appears to be made of wood. The wood has now split and is cracked. This repair should be performed using only manufacturer-approved parts.



Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

Id Location
20151 Roosevelt Park

Observation/Recommendation
Pinch, Crush, and Shear Points

There shall be no pinch, crush and shear points caused by junctures of two components moving relative to one another, or at an opening present at the junction of a stationary support and a rigid supporting member for a swing element (that is, pendulum, see saw, glide rides, and so forth) while the swinging elements are within their normal swing angles. A pinch, crush, or shear point is any point that entraps at one or more positions a 0.62 inch diameter rod.
ASTM-F1487 6.5

Recommendation

There should be no accessible pinch, crush, or shearing points on playground equipment that could injure children. There appears to be excessive wear, and I could fit the pinch point dowel into the gap.



Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

<u>Id</u>	<u>Location</u>	<u>Observation/Recommendation</u>
20152	Liberty Heights Park	<p>Hardware</p> <p>When installed in accordance with the manufacturer's instructions, fasteners, connecting, and covering devices shall not loosen or be removable without the use of tools. Lock washers, self-locking nuts, or other locking means shall be provided for all nuts and bolts to protect them from detachment. Hardware in moving joints shall also be secured against unintentional loosening.</p> <p>ASTM-F1487 4.2.2</p>

Recommendation

All hardware should be installed so that it will not loosen or can not be removed without the use of tools. The track around the play structure appears to have moved and needs to be adjusted.



Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

<u>Id</u>	<u>Location</u>	<u>Observation/Recommendation</u>
20153	Liberty Heights Park	Sharp Points, Corners or Edges All corners, metal and wood, should be rounded. CPSC 3.4

Recommendation

Sharp points, corners, or edges on any part of the playground or playground equipment may cut or puncture a child's skin. Sharp edges can cause serious lacerations if protective measures are not taken. The track has a section that is broken and is sharp.



Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

Id Location
20154 Liberty Heights
Park

Observation/Recommendation

Hardware

When installed in accordance with the manufacturer's instructions, fasteners, connecting, and covering devices shall not loosen or be removable without the use of tools. Lock washers, self-locking nuts, or other locking means shall be provided for all nuts and bolts to protect them from detachment. Hardware in moving joints shall also be secured against unintentional loosening.

ASTM-F1487 4.2.2

Recommendation

All hardware should be installed so that it will not loosen or can not be removed without the use of tools. There is a bolt that is missing from the track.



Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

Id Location
20155 Liberty Heights
Park

Observation/Recommendation

Maintenance

Inspections alone do not constitute a comprehensive maintenance program. Any problems found during the inspection should be noted and fixed as soon as possible. All repairs and replacements of equipment parts should be completed following the manufacturer's instructions.

CPSC 4.2

Recommendation

The surfacing has damage and needs to be patched.



Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

<u><i>Id</i></u>	<u><i>Location</i></u>	<u><i>Observation/Recommendation</i></u>
20156	Liberty Heights Park	Maintenance Inspections alone do not constitute a comprehensive maintenance program. Any problems found during the inspection should be noted and fixed as soon as possible. All repairs and replacements of equipment parts should be completed following the manufacturer's instructions. CPSC 4.2

Recommendation

The handle on this equipment is broken and should be replaced.



Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

Id Location
20157 Liberty Heights
Park

Observation/Recommendation

Hardware

When installed in accordance with the manufacturer's instructions, fasteners, connecting, and covering devices shall not loosen or be removable without the use of tools. Lock washers, self-locking nuts, or other locking means shall be provided for all nuts and bolts to protect them from detachment. Hardware in moving joints shall also be secured against unintentional loosening.

ASTM-F1487 4.2.2

Recommendation

It appears that the rivet for the handle is coming out and should be repaired.



Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

<u>Id</u>	<u>Location</u>	<u>Observation/Recommendation</u>
20158	Liberty Heights Park	<p>Hardware</p> <p>When installed in accordance with the manufacturer's instructions, fasteners, connecting, and covering devices shall not loosen or be removable without the use of tools. Lock washers, self-locking nuts, or other locking means shall be provided for all nuts and bolts to protect them from detachment. Hardware in moving joints shall also be secured against unintentional loosening.</p> <p>ASTM-F1487 4.2.2</p>

Recommendation

All hardware should be installed so that it will not loosen or can not be removed without the use of tools. The panel is loose and should be tightened.



Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

<u>Id</u>	<u>Location</u>	<u>Observation/Recommendation</u>
20159	Liberty Heights Park	Signage and/or Labeling Although the intended user group should be obvious from the design and scale of equipment, signs and/or labels posted in the playground area or on the equipment should give some guidance to supervisors as to the age appropriateness of the equipment. CPSC 2.2.6



Recommendation

Part of the sign is missing.

Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

Id Location
20160 Liberty Heights
Park

Observation/Recommendation

S - Hooks

S-hook connectors are subject to these further requirements. If any of the following requirements are not met, an entanglement hazard exists: (1) No portion of the closed end of an S-hook lower loop may project beyond the vertical boundary established by the upper loop. (2) An S-hook upper loop may align with, may partially overlap, or may completely overlap the connector body. If the upper loop completely overlaps the connector body, it must not extend past the connector body. (3) An S-hook lower loop must align with the connector body and not overlap it in any way. ASTM-F1487 6.4.5.1

Recommendation

The S-hook presents an entanglement hazard.



Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

Id Location
20161 Liberty Heights
Park


Observation/Recommendation

S - Hooks

Connecting Devices - Connecting devices such as, but not limited to, "S"-hooks, pelican hooks and C-hooks, when properly closed, are not entanglement hazards. These connectors are considered closed when there is no gap or space greater than 0.04 inch when measured with a feeler gage.
ASTM-F1487 6.4.5

Recommendation

All S-hooks should be properly closed to a gap of 0.04 inches (a dime should not be able to be passed through the gap).

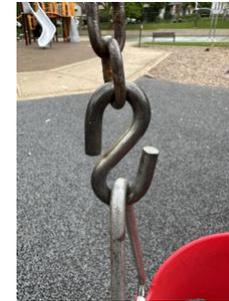

Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

Id Location
20162 Liberty Heights
Park

Observation/Recommendation

Painted Surfaces

Metals not inherently corrosion resistant should be painted, galvanized, or otherwise treated to prevent rust. Paints and other finishes should be maintained to prevent rusting of exposed metals and to minimize children playing with peeling paint and paint flakes. CPSC 2.5.4

Recommendation

All painted surfaces must be maintained in good condition to eliminate rusting and peeling paint.



Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

City-Wide

<u><i>Id</i></u>	<u><i>Location</i></u>	<u><i>Observation/Recommendation</i></u>
20163	Liberty Heights Park	Basketball Court The surface of the outdoor basketball court should be maintained in a condition that is safe for the users. This means a level playing surface with minimal cracking. None Recommendation The hoop is missing on the basketball court.



Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

<u>Id</u>	<u>Location</u>	<u>Observation/Recommendation</u>
20164	Burnham Pointe Park	Insects Warm weather can bring out all sorts of wildlife, including bees and wasps. These bugs can be a threat to the well-being of you and your playground patrons, and they can be especially challenging to eliminate once they've nested. None



Recommendation

I am recommending that you try to fill the gaps in the wood to prevent insects from building nests.

Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

City-Wide

<u>Id</u>	<u>Location</u>	<u>Observation/Recommendation</u>
20165	Burnham Pointe Park	Sharp Points, Corners or Edges Wood parts should be smooth and free from splinters. CPSC 3.4 Recommendation A piece of wood is loose and should be looked at for possible hazards.



Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

Id Location
20166 Burnham Pointe
Park

Observation/Recommendation

Slides

The platform should not have any spaces or gaps that could trap strings, clothing, body parts, etc. between the platform and the start of the slide chute.

CPSC 5.3.6.2

Recommendation

There must be no spaces or gaps between the platform and the start of the slide.



Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

<u><i>Id</i></u>	<u><i>Location</i></u>	<u><i>Observation/Recommendation</i></u>
20167	Burnham Pointe Park	Sharp Points, Corners or Edges Wood parts should be smooth and free from splinters. CPSC 3.4

Recommendation

Sharp points, corners, or edges on any part of the playground or playground equipment may cut or puncture a child's skin. Sharp edges can cause serious lacerations if protective measures are not taken.



Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

Id Location
20168 Burnham Pointe
Park

Observation/Recommendation

Protrusions and Projections

Protrusions: There shall be no protrusions on public play equipment.
ASTM-F1487 6.3

Recommendation

This piece of equipment has a protrusion hazard, and the hazard must be eliminated. If you were to tighten the eye bolt to reduce the length, this would eliminate the protrusion hazard.



Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)


City-Wide

<u><i>Id</i></u>	<u><i>Location</i></u>	<u><i>Observation/Recommendation</i></u>
20169	Veterans Memorial Park	Slides

All slides should have an exit region to help children maintain their balance and facilitate a smooth transition from sitting to standing when exiting. For preschool and school-age the chute exit region should: - Be at least 11 inches long. - Be no more than 11 inches above the protective surfacing if the slide is no greater than 4 feet high. - Be at least 7 inches but not more than 15 inches above the protective surfacing if the slide is over 4 feet high.
CPSC 5.3.6.4

Recommendation

The slide chute exit is too high above the protective surfacing material. The exit is at 17 inches.

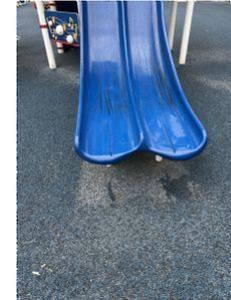

Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

<u>Id</u>	<u>Location</u>	<u>Observation/Recommendation</u>
20170	Veterans Memorial Park	Hardware When installed in accordance with the manufacturer's instructions, fasteners, connecting, and covering devices shall not loosen or be removable without the use of tools. Lock washers, self-locking nuts, or other locking means shall be provided for all nuts and bolts to protect them from detachment. Hardware in moving joints shall also be secured against unintentional loosening. ASTM-F1487 4.2.2

Recommendation

All hardware should be installed so that it will not loosen or can not be removed without the use of tools. The panel is loose and should be tightened.



Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

<u><i>Id</i></u>	<u><i>Location</i></u>	<u><i>Observation/Recommendation</i></u>
20171	Veterans Memorial Park	Maintenance

Inspections alone do not constitute a comprehensive maintenance program. Any problems found during the inspection should be noted and fixed as soon as possible. All repairs and replacements of equipment parts should be completed following the manufacturer's instructions.
CPSC 4.2

Recommendation

All hazards found during inspections should be eliminated as soon as possible. Repairs and replacements should also be documented. Repairs should only be done with manufacturer approved parts.



Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

<u><i>Id</i></u>	<u><i>Location</i></u>	<u><i>Observation/Recommendation</i></u>
20172	Veterans Memorial Park	Painted Surfaces

Metals not inherently corrosion resistant should be painted, galvanized, or otherwise treated to prevent rust. Paints and other finishes should be maintained to prevent rusting of exposed metals and to minimize children playing with peeling paint and paint flakes. CPSC 2.5.4

Recommendation

All painted surfaces must be maintained in good condition to eliminate rusting and peeling paint.



Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

<u>Id</u>	<u>Location</u>	<u>Observation/Recommendation</u>
20173	Veterans Memorial Park	Painted Surfaces

Metals not inherently corrosion resistant should be painted, galvanized, or otherwise treated to prevent rust. Paints and other finishes should be maintained to prevent rusting of exposed metals and to minimize children playing with peeling paint and paint flakes. CPSC 2.5.4

Recommendation

All painted surfaces must be maintained in good condition to eliminate rusting and peeling paint.



Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

<u><i>Id</i></u>	<u><i>Location</i></u>	<u><i>Observation/Recommendation</i></u>
20174	Veterans Memorial Park	Hardware

When installed in accordance with the manufacturer's instructions, fasteners, connecting, and covering devices shall not loosen or be removable without the use of tools. Lock washers, self-locking nuts, or other locking means shall be provided for all nuts and bolts to protect them from detachment. Hardware in moving joints shall also be secured against unintentional loosening.

ASTM-F1487 4.2.2

Recommendation

All hardware should be installed so that it will not loosen or can not be removed without the use of tools. On this playground equipment, there are numerous screws missing that need to be replaced.



Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

<u><i>Id</i></u>	<u><i>Location</i></u>	<u><i>Observation/Recommendation</i></u>
20175	Veterans Memorial Park	Maintenance

Inspections alone do not constitute a comprehensive maintenance program. Any problems found during the inspection should be noted and fixed as soon as possible. All repairs and replacements of equipment parts should be completed following the manufacturer's instructions.
CPSC 4.2

Recommendation

All hazards found during inspections should be eliminated as soon as possible. Repairs and replacements should also be documented. Parts of the panel are broken and need to be replaced.



Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

<u>Id</u>	<u>Location</u>	<u>Observation/Recommendation</u>
20176	Veterans Memorial Park	Hardware When installed in accordance with the manufacturer's instructions, fasteners, connecting, and covering devices shall not loosen or be removable without the use of tools. Lock washers, self-locking nuts, or other locking means shall be provided for all nuts and bolts to protect them from detachment. Hardware in moving joints shall also be secured against unintentional loosening. ASTM-F1487 4.2.2

Recommendation

All hardware should be installed so that it will not loosen or can not be removed without the use of tools. There is a screw missing on this play equipment and it appears part of the equipment itself is missing.



Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

<u>Id</u>	<u>Location</u>	<u>Observation/Recommendation</u>
20177	Veterans Memorial Park	Protrusions and Projections

Protrusions: There shall be no protrusions on public play equipment.
ASTM-F1487 6.3

Recommendation

This piece of equipment has a protrusion hazard, and the hazard must be eliminated. There was a stick that was pushed through the water drain hole in the surface. I removed this, but I wanted you to be aware and look out for these in the future.



Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.


Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

<u>Id</u>	<u>Location</u>	<u>Observation/Recommendation</u>
20178	Veterans Memorial Park	Hardware When installed in accordance with the manufacturer's instructions, fasteners, connecting, and covering devices shall not loosen or be removable without the use of tools. Lock washers, self-locking nuts, or other locking means shall be provided for all nuts and bolts to protect them from detachment. Hardware in moving joints shall also be secured against unintentional loosening. ASTM-F1487 4.2.2

Recommendation

All hardware should be installed so that it will not loosen or can not be removed without the use of tools. The handle is loose and should be tightened.

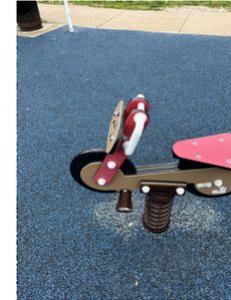

Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

<u><i>Id</i></u>	<u><i>Location</i></u>	<u><i>Observation/Recommendation</i></u>
20179	Veterans Memorial Park	Maintenance Inspections alone do not constitute a comprehensive maintenance program. Any problems found during the inspection should be noted and fixed as soon as possible. All repairs and replacements of equipment parts should be completed following the manufacturer's instructions. CPSC 4.2



Recommendation

All hazards found during inspections should be eliminated as soon as possible. Repairs and replacements should also be documented. The surfacing is damaged and may need to be patched.

Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

<u><i>Id</i></u>	<u><i>Location</i></u>	<u><i>Observation/Recommendation</i></u>
20180	Veterans Memorial Park	Hardware When installed in accordance with the manufacturer's instructions, fasteners, connecting, and covering devices shall not loosen or be removable without the use of tools. Lock washers, self-locking nuts, or other locking means shall be provided for all nuts and bolts to protect them from detachment. Hardware in moving joints shall also be secured against unintentional loosening. ASTM-F1487 4.2.2

Recommendation

All hardware should be installed so that it will not loosen or can not be removed without the use of tools. The glider is missing the grab bar.



Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

<u>Id</u>	<u>Location</u>	<u>Observation/Recommendation</u>
20181	Arnold Klentz Park	Signage and/or Labeling

Although the intended user group should be obvious from the design and scale of equipment, signs and/or labels posted in the playground area or on the equipment should give some guidance to supervisors as to the age appropriateness of the equipment.
CPSC 2.2.6

Recommendation

Signs should be posted to give guidance as to the age appropriateness of the playground equipment.



Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

<u><i>Id</i></u>	<u><i>Location</i></u>	<u><i>Observation/Recommendation</i></u>
20182	Arnold Klentz Park	Maintenance

Loose-fill surfacing materials require special maintenance. High-use public playgrounds, such as child care centers and schools, should be checked frequently to ensure surfacing has not displaced significantly, particularly in areas of the playground most subject to displacement (e.g., under swings and slide exits).

CPSC 4.3

Recommendation

Mark ideal surfacing depths on equipment posts. Displaced loose-fill surfacing should be raked back into proper place so that constant depth is maintained throughout the playground.



Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

<u>Id</u>	<u>Location</u>	<u>Observation/Recommendation</u>
20183	Arnold Klentz Park	Hardware

When installed in accordance with the manufacturer's instructions, fasteners, connecting, and covering devices shall not loosen or be removable without the use of tools. Lock washers, self-locking nuts, or other locking means shall be provided for all nuts and bolts to protect them from detachment. Hardware in moving joints shall also be secured against unintentional loosening.

ASTM-F1487 4.2.2

Recommendation

All hardware should be installed so that it will not loosen or can not be removed without the use of tools. The bar is loose and should be tightened.



Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

<u>Id</u>	<u>Location</u>	<u>Observation/Recommendation</u>
20184	Arnold Klentz Park	Hardware

When installed in accordance with the manufacturer's instructions, fasteners, connecting, and covering devices shall not loosen or be removable without the use of tools. Lock washers, self-locking nuts, or other locking means shall be provided for all nuts and bolts to protect them from detachment. Hardware in moving joints shall also be secured against unintentional loosening.

ASTM-F1487 4.2.2

Recommendation

All hardware should be installed so that it will not loosen or can not be removed without the use of tools. The rivet is coming out of the cap and should be looked at.



Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

<u>Id</u>	<u>Location</u>	<u>Observation/Recommendation</u>
20185	Rogers Park (75th Street)	<p>Accessibility</p> <p>If the use zone of a playground is not entirely surfaces with an accessible material, at least one accessible route within the use zone shall be provided from the perimeter to all accessible play structures or components within the playground. For accessible play components, such as slides, where the access and egress point are not the same, an accessible route will be provided at both points.</p> <p>ADA 2010 105.2.3</p>



Recommendation

An ADA accessible route must be provided to get to the playground and also to gain access to all accessible play structures or components within the playground.

Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

<u>Id</u>	<u>Location</u>	<u>Observation/Recommendation</u>
20186	Rogers Park (75th Street)	Maintenance Inspections alone do not constitute a comprehensive maintenance program. Any problems found during the inspection should be noted and fixed as soon as possible. All repairs and replacements of equipment parts should be completed following the manufacturer's instructions. CPSC 4.2



Recommendation

I found a lighter in the mulch of the playground and properly disposed of it.

Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

<u>Id</u>	<u>Location</u>	<u>Observation/Recommendation</u>
20187	Rogers Park (75th Street)	<p>Painted Surfaces</p> <p>Metals not inherently corrosion resistant should be painted, galvanized, or otherwise treated to prevent rust. Paints and other finishes should be maintained to prevent rusting of exposed metals and to minimize children playing with peeling paint and paint flakes. CPSC 2.5.4</p>



Recommendation

All painted surfaces must be maintained in good condition to eliminate rusting and peeling paint.

Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

<u>Id</u>	<u>Location</u>	<u>Observation/Recommendation</u>
20188	Rogers Park (75th Street)	Maintenance Inspections alone do not constitute a comprehensive maintenance program. Any problems found during the inspection should be noted and fixed as soon as possible. All repairs and replacements of equipment parts should be completed following the manufacturer's instructions. CPSC 4.2

Recommendation

All hazards found during inspections should be eliminated as soon as possible. Repairs and replacements should also be documented. The railing is loose and should be checked out.



Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

City-Wide

<u><i>Id</i></u>	<u><i>Location</i></u>	<u><i>Observation/Recommendation</i></u>
20189	Rogers Park (75th Street)	Entanglement Bolts should not expose more than two threads beyond the end of the nut. CPSC 3.2 Recommendation There must never be more than two threads exposed beyond the end of the nut.



Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

<u>Id</u>	<u>Location</u>	<u>Observation/Recommendation</u>
20190	Rogers Park (75th Street)	<p>Hardware</p> <p>When installed in accordance with the manufacturer's instructions, fasteners, connecting, and covering devices shall not loosen or be removable without the use of tools. Lock washers, self-locking nuts, or other locking means shall be provided for all nuts and bolts to protect them from detachment. Hardware in moving joints shall also be secured against unintentional loosening.</p> <p>ASTM-F1487 4.2.2</p>



Recommendation

All hardware should be installed so that it will not loosen or can not be removed without the use of tools. There appears to be a missing component on this upright.

Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

<u>Id</u>	<u>Location</u>	<u>Observation/Recommendation</u>
20191	Rogers Park (75th Street)	Maintenance Loose-fill surfacing materials require special maintenance. High-use public playgrounds, such as child care centers and schools, should be checked frequently to ensure surfacing has not displaced significantly, particularly in areas of the playground most subject to displacement (e.g., under swings and slide exits). CPSC 4.3



Recommendation

Mark ideal surfacing depths on equipment posts. The surfacing is not deep enough and more should be added to attain the proper depth.

Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

<u><i>Id</i></u>	<u><i>Location</i></u>	<u><i>Observation/Recommendation</i></u>
20192	Rogers Park (75th Street)	Maintenance Loose-fill surfacing materials require special maintenance. High-use public playgrounds, such as child care centers and schools, should be checked frequently to ensure surfacing has not displaced significantly, particularly in areas of the playground most subject to displacement (e.g., under swings and slide exits). CPSC 4.3

Recommendation

Mark ideal surfacing depths on equipment posts.
Displaced loose-fill surfacing should be raked back into proper place so that constant depth is maintained throughout the playground.



Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

<u><i>Id</i></u>	<u><i>Location</i></u>	<u><i>Observation/Recommendation</i></u>
20193	Rogers Park (75th Street)	Protrusions and Projections

Protrusions: There shall be no protrusions on public play equipment.
ASTM-F1487 6.3

Recommendation

This piece of equipment has a protrusion hazard and the hazard must be eliminated.



Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

<u><i>Id</i></u>	<u><i>Location</i></u>	<u><i>Observation/Recommendation</i></u>
20194	Rogers Park (75th Street)	Maintenance Inspections alone do not constitute a comprehensive maintenance program. Any problems found during the inspection should be noted and fixed as soon as possible. All repairs and replacements of equipment parts should be completed following the manufacturer's instructions. CPSC 4.2



Recommendation

Repairs should be made with manufacturer-approved materials.

Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

<u>Id</u>	<u>Location</u>	<u>Observation/Recommendation</u>
20195	Reservoir Park	Hardware When installed in accordance with the manufacturer's instructions, fasteners, connecting, and covering devices shall not loosen or be removable without the use of tools. Lock washers, self-locking nuts, or other locking means shall be provided for all nuts and bolts to protect them from detachment. Hardware in moving joints shall also be secured against unintentional loosening. ASTM-F1487 4.2.2

Recommendation

All hardware should be installed so that it will not loosen or can not be removed without the use of tools. The sign is missing a bolt.



Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

<u>Id</u>	<u>Location</u>	<u>Observation/Recommendation</u>
20196	Reservoir Park	Protrusions and Projections

Protrusions: There shall be no protrusions on public play equipment.
ASTM-F1487 6.3

Recommendation

This piece of equipment has a protrusion hazard, and the hazard must be eliminated. There appears to be a piece missing on the back of the play equipment.



Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

Id Location
20197 Reservoir Park

Observation/Recommendation
Painted Surfaces

Metals not inherently corrosion resistant should be painted, galvanized, or otherwise treated to prevent rust. Paints and other finishes should be maintained to prevent rusting of exposed metals and to minimize children playing with peeling paint and paint flakes.
CPSC 2.5.4

Recommendation

All painted surfaces must be maintained in good condition to eliminate rusting and peeling paint.



Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

Id Location
20198 Reservoir Park

Observation/Recommendation


Maintenance

Inspections alone do not constitute a comprehensive maintenance program. Any problems found during the inspection should be noted and fixed as soon as possible. All repairs and replacements of equipment parts should be completed following the manufacturer's instructions.

CPSC 4.2

Recommendation

The chain on the ADA swing appears to be tangled. I was unable to untangle it during my inspection.

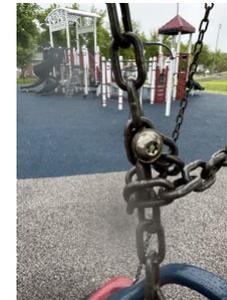

Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

Id Location
20199 Reservoir Park

Observation/Recommendation

Maintenance

Inspections alone do not constitute a comprehensive maintenance program. Any problems found during the inspection should be noted and fixed as soon as possible. All repairs and replacements of equipment parts should be completed following the manufacturer's instructions.

CPSC 4.2

Recommendation

All hazards found during inspections should be eliminated as soon as possible. Repairs and replacements should also be documented. The play panel is cracked and needs to be repaired.



Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

Id Location
20200 Reservoir Park

Observation/Recommendation
Protective Surface Material

The owner/operator shall maintain and repair the impact attenuating surfacing within the use zone of each play structure in accordance with designer/manufacturer's installation and maintenance instructions and in compliance with Specifications F1487 and F1292 appropriate for the fall height of each play structure and, where applicable, maintains the surfacing to address the intent of the DOJ 210 Standard for Accessible Design.
ASTM-F1487 13.2.1

Recommendation

The protective surfacing appears to have been damaged and needs to be patched.



Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

Id Location
20201 Reservoir Park

Observation/Recommendation
Painted Surfaces

Metals not inherently corrosion resistant should be painted, galvanized, or otherwise treated to prevent rust. Paints and other finishes should be maintained to prevent rusting of exposed metals and to minimize children playing with peeling paint and paint flakes. CPSC 2.5.4

Recommendation

All painted surfaces must be maintained in good condition to eliminate rusting and peeling paint.



Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.

Playground Safety Inspection Report - West Allis (5-28-2025)

City-Wide

<u><i>Id</i></u>	<u><i>Location</i></u>	<u><i>Observation/Recommendation</i></u>
20202	Reservoir Park	<p>Hardware</p> <p>When installed in accordance with the manufacturer's instructions, fasteners, connecting, and covering devices shall not loosen or be removable without the use of tools. Lock washers, self-locking nuts, or other locking means shall be provided for all nuts and bolts to protect them from detachment. Hardware in moving joints shall also be secured against unintentional loosening.</p> <p>ASTM-F1487 4.2.2</p>

Recommendation

All hardware should be installed so that it will not loosen or can not be removed without the use of tools. A bolt is missing from the play panel.



Target Completion Date:

Responsible Party:

Date Corrected:

The inspector does not represent that all possible or significant hazards on your premises or in your operations have been identified in this inspection. This inspection was performed for your information only, and by performing this inspection, the inspector does not undertake to bring you into compliance with any local, state or federal laws, common law duties or contractual obligations. Moreover, by performing this inspection the inspector has not and does not assume or discharge any obligations you may have to identify, manage, control or correct any hazard on your premises or in your operations.